


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

West Meander Corner of the NE¹/₄ corner of Section 20, Town 11 North, Range 21 East, Town of Saukville, Ozaukee County, WI

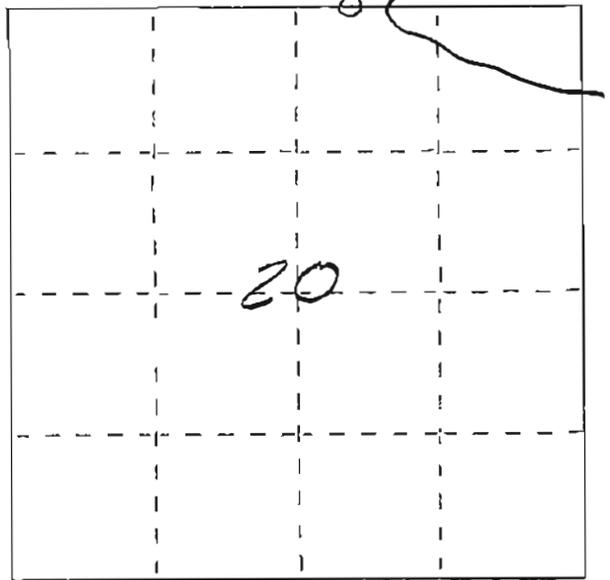


(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed. The Meander corner was set at the Most Easterly corner of the parcel described in Volume 156, Page 500. An iron pipe was found at this point and assumed to be on the North line of the NE¹/₄ of Section 20 as called for in said Volume 156, Page 500. Original location of the Meander corner was set 432.96 feet East of the N¹/₄ corner (6.56 chains-taken from survey notes of L. Towsley, April 12, 1876 to Nov. 3, 1881) falling far West of the lake. Field investigation proved the Original Meander corner to be Lost. The new location of the Meander corner lies 870.40 feet East of the N¹/₄ corner and was Established in accordance with the "Manual of Surveying Instructions, 1947" found in Section 377 (Lost Meander Corners) on Pages 298 and 299.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.


Note: Meander corner is a cast Aluminum Bernstein Monument.

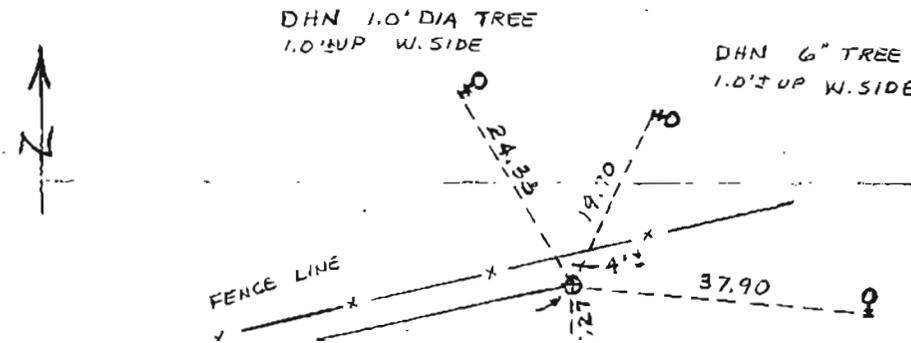

reference to the U.S. public land survey system.

O = Corner monument restored.

West Meander Corner of the NE corner of Section 20, Town 11 North, Range 21 East, Town of Saukville, Ozaukee County, WI

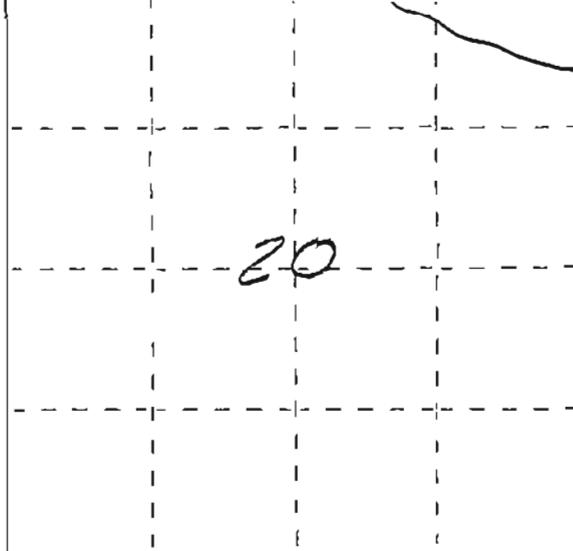


(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed. The Meander corner was set at the Most Easterly corner of the parcel described in Volume 156, Page 500. An iron pipe was found at this point and assumed to be on the North line of the NE 1/4 of Section 20 as called for in said Volume 156, Page 500. Original location of the Meander corner was set 432.96 feet East of the N 1/4 corner (6.56 chains-taken from survey notes of L. Towsley, April 12, 1876 to Nov. 3, 1881) falling far West of the lake. Field investigation proved the Original Meander corner to be Lost. The new location of the Meander corner lies 870.40 feet East of the N 1/4 corner and was Established in accordance with the "Manual of Surveying Instructions, 1947" found in Section 377 (Lost Meander Corners) on Pages 298 and 299.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

Note: Meander corner is a cast Aluminum Bernstein Monument.

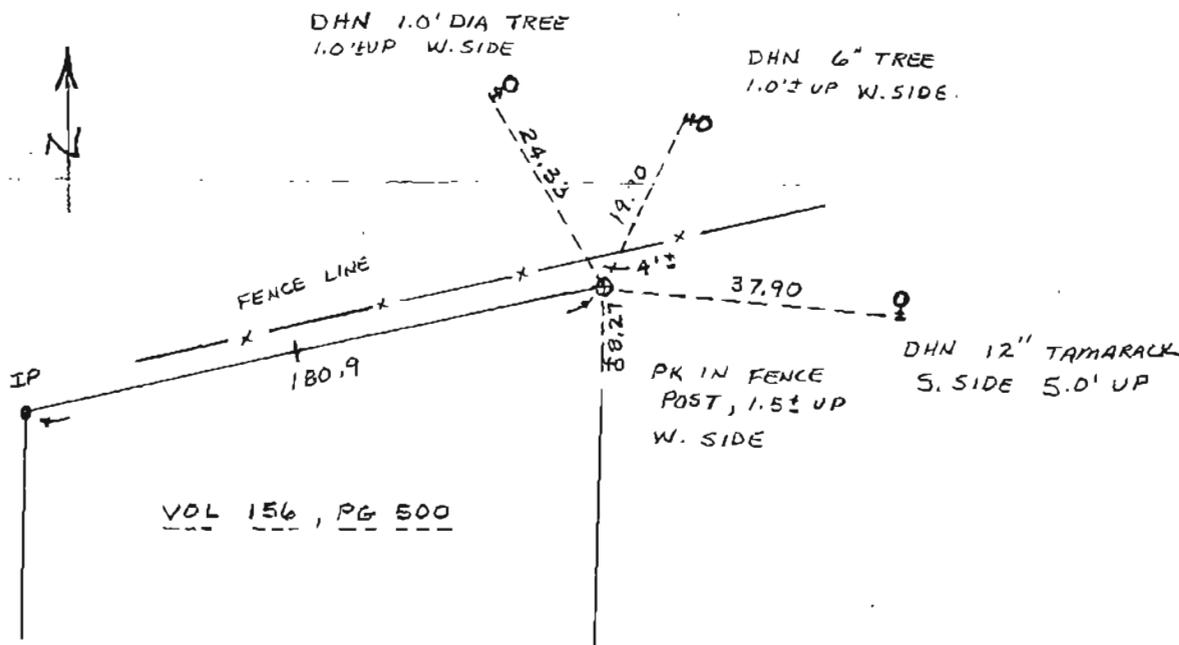

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Found iron pipe along North line called for in Volume 156 on Page 500

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

See (b)




(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Found iron pipe along North line called for in Volume 156 on Page 500

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

See (b)

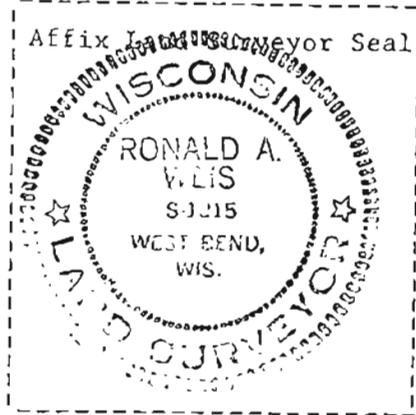

Ronald A. Weis

(i) I, Ronald A. Weis (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Ronald A. Weis
Signature

DEC. 29, 1983
Date

PLS-4