


"U.S. PUBLIC LAND SURVEY MONUMENT RECORD" OZAUKEE COUNTY, WISCONSIN

TYPE OF MONUMENT: Berntsen monument with aluminum cap
 STATE PLANE COORDINATES: N: 510790.44
 E: 2550133.97
 ELEVATION: 752.64 M.S.L. DATUM: 1929
 THETA ANGLE: _____
 FIELD BOOK: _____ PAGE: _____
 FIELDWORK BY: KAPUR AND ASSOCIATES/TDM GENSKE 1998
 RECORD DRAWN BY: MARK BANTON
 CONTRL ACCURACY: _____
 HORIZONTAL: 3RD ORDER, CLASS 1 VERTICAL: 3RD ORDER

CORNER INDEX No. 531
 SECTION 36
 TOWNSHIP 11
 RANGE 21

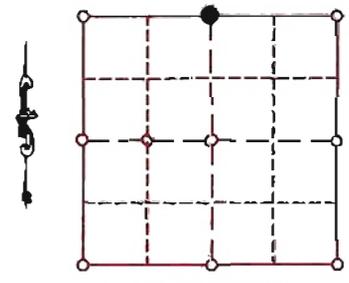

LOCATION

BASIS OF MONUMENT LOCATION

1986- Kurt Bauer found a berntsen monument with aluminum cap as set to mark this corner as set by Tom Genske, S-1317 in April 1986 to mark this corner; replacing a broken concrete monument w/ brass plug as set by James Eide, S-3 in November of 1966 to mark this corner replacing an old cut limestone then marking this corner.
 1988- Tom Genske, S-1317 set new ties prior to sewer construction
 1998 - Kapur and Associates remonumentation program
 2008 - redrawn by Mark Banton- S-1691 to reflect co-ordinates established by Kapur and Associates and ties by Tom Genske

SEAL:




DATA SHOWN HEREON
IS CERTIFIED AS CORRECT:

Mark Banton
Ozaukee County Surveyor

DATE: 11/10/08

TIE SKETCH

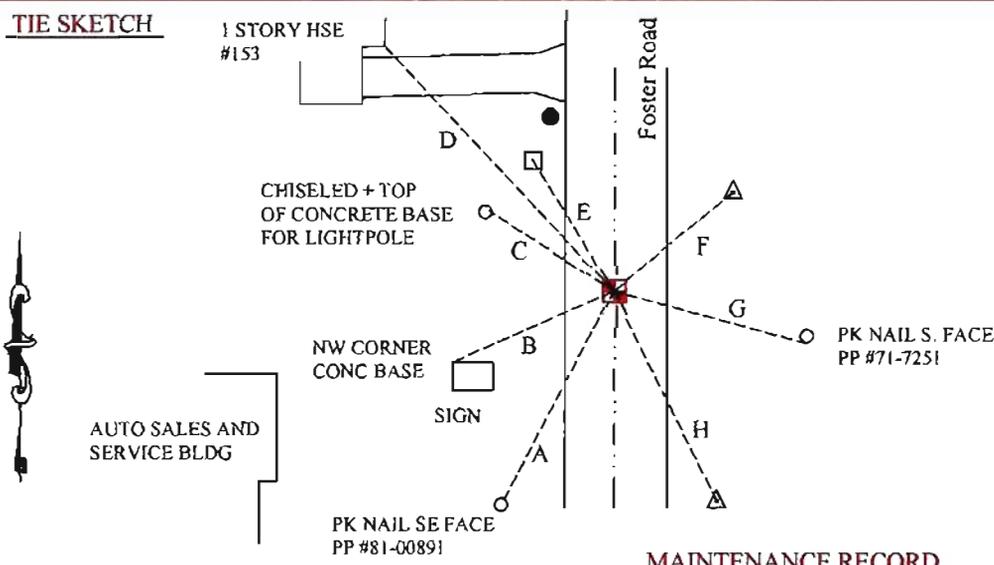

- A = 104.60
- B = 62.51
- C = 48.75
- D = 171.22
- E = 125.45
- F = 99.93
- G = 88.52
- H = 99.84

MAINTENANCE RECORD

- MONUMENT LEGEND**
- = BERNTSEN MONUMENT (SEE TYPE OF MON. ABOVE)
 - = CONCRETE MONUMENT W/ BRASS CAP
 - = CONCRETE MONUMENT W/ CROSS
 - = 5/8" REBAR WITH ALUMINUM CAP

DATE	BY WHOM	REMARKS
11/10/08	M. BANTON	Redraw from tie sheet and re-number corner